


十字椭圆机螺钉



- 材料 铁
- 表面处理 三价镀彩锌
黑色三价镀彩锌

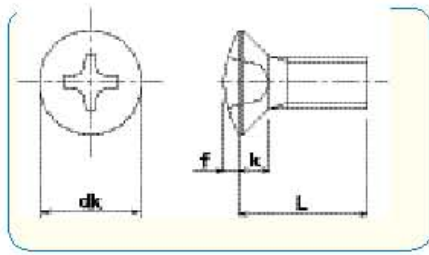


| | M2 | M2.5 | M2.6 | M3 | M3.5 | M4 | M5 | M6 | M8 | |
|------|-----|------|------|------|------|-----|-----|-----|-----|--|
| dk | 4 | 5 | 5.2 | 6 | 7 | 8 | 10 | 12 | 16 | |
| k | 1.2 | 1.45 | 1.5 | 1.75 | 2 | 2.3 | 2.8 | 3.4 | 4.4 | |
| f | 0.4 | 0.55 | 0.6 | 0.7 | 0.8 | 0.9 | 1.2 | 1.4 | 1.8 | |
| 扳手尺寸 | 1 | | | 2 | | | | 3 | | |

| | | 件 / 箱 | | | | | | | | |
|----|----|--------|-------|-------|-------|-------|-------|-------|-----|-----|
| d | L | M2 | M2.5 | M2.6 | M3 | M3.5 | M4 | M5 | M6 | M8 |
| 3 | 3 | 12,000 | | | | | | | | |
| 4 | 4 | 10,000 | 5,000 | 5,000 | 4,000 | | | | | |
| 5 | 5 | 8,000 | 5,000 | 5,000 | 3,000 | 4,000 | | | | |
| 6 | 6 | 8,000 | 4,500 | 4,500 | 2,500 | 4,000 | 2,200 | | | |
| 8 | 8 | 6,000 | 3,500 | 3,500 | 2,200 | 3,000 | 2,000 | 1,000 | 700 | |
| 10 | 10 | 5,000 | 3,000 | 3,000 | 2,000 | 2,500 | 1,600 | 900 | 600 | |
| 12 | 12 | | | 2,500 | 2,500 | 2,000 | 1,500 | 800 | 600 | 300 |
| 14 | 14 | | | 2,000 | 2,200 | | 1,200 | 800 | 500 | |
| 15 | 15 | | | 1,800 | 2,000 | | 1,200 | 700 | 500 | 250 |
| 16 | 16 | | | 1,800 | 2,000 | | 1,000 | 700 | 450 | 250 |
| 18 | 18 | | | | 1,600 | | 1,000 | 600 | 400 | 200 |
| 20 | 20 | | | | 1,500 | | 900 | 500 | 350 | 200 |
| 22 | 22 | | | | 1,400 | | 800 | 700 | 500 | |
| 25 | 25 | | | | 1,200 | | 700 | 700 | 500 | 220 |
| 30 | 30 | | | | 1,000 | | 600 | 600 | 400 | 200 |
| 35 | 35 | | | | 700 | | 500 | 500 | 300 | 180 |
| 40 | 40 | | | | 600 | | 600 | 400 | 300 | 160 |
| 45 | 45 | | | | 800 | | 500 | 350 | 250 | 150 |
| 50 | 50 | | | | 600 | | 450 | 300 | 200 | 130 |

* ... 只有三价镀彩锌

不锈钢 十字椭圆机螺钉

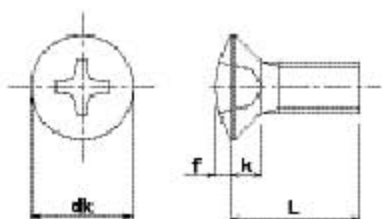

●材料
不锈钢 A2



| | M3 | M4 | M5 | M6 |
|------|------|-----|-----|-----|
| dk | 6 | 8 | 10 | 12 |
| k | 1.75 | 2.3 | 2.8 | 3.4 |
| f | 0.7 | 0.9 | 1.2 | 1.4 |
| 扳手尺寸 | 2 | | 3 | |



| | | 件 / 箱 | | | |
|----|-------|-------|-------|-----|----|
| d | L | M3 | M4 | M5 | M6 |
| 5 | 3,000 | | | | |
| 6 | 3,000 | 2,000 | | | |
| 8 | 2,000 | 1,000 | 1,000 | | |
| 10 | 2,000 | 1,000 | 500 | 500 | |
| 12 | 2,000 | 1,000 | 500 | 500 | |
| 14 | 2,000 | 500 | 500 | 500 | |
| 15 | 1,000 | 500 | 500 | 500 | |
| 16 | 1,000 | 1,000 | 500 | 200 | |
| 18 | 1,000 | 500 | 500 | 200 | |
| 20 | 1,000 | 500 | 500 | 200 | |
| 22 | | | 500 | | |
| 25 | 1,000 | 500 | 500 | 200 | |
| 30 | 500 | 500 | 200 | 200 | |
| 35 | | 500 | 200 | 200 | |
| 40 | | 200 | 200 | 100 | |
| 45 | | 200 | 200 | 100 | |
| 50 | | 200 | 100 | 100 | |